


### RSK SERIES Direct Burial Splice Kits with Rubber Covers

#### RECOMMENDED INSTALLATION INSTRUCTIONS

1. Select correct cut-off ring for cable being used. Cut insulating sleeve and cap so that cable size desired is left showing.

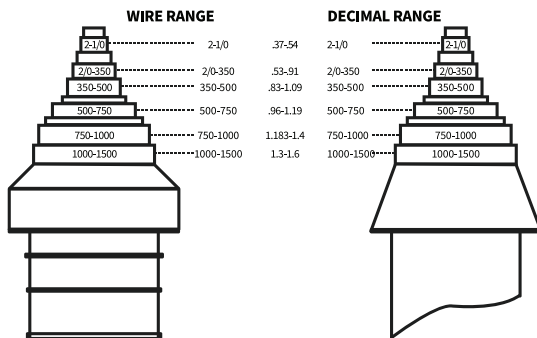

2. Bevel or pencil cable insulation to ease insulation. See chart below for strip length and apply silicone grease to cut openings.



3. Apply silicone grease to cut openings on sleeve and cap. Slide them over the cable ends as shown.

4. Install splice connector. Use torque chart below for proper specs.



5. Apply silicone grease to sleeve opening. Slide sleeve and cap\* together, centering the housing over the spliced connection.

\* To accommodate some splices, it may be necessary to remove the hard grey liner in the cap.

KIT TYPE	WIRE SIZE	WIRE STRIP LENGTH	TIGHTENING TORQUE IN IN. LBS
RSK-2/0	#14 - #10	1/4"	35
	#8		40
	#6 - #4		45
	#3 - 2/0 AWG		50
RSK-350	#6 - #4	3/4"	120
	#2 - 350 AWG		240
RSK-500	2/0 AWG - 350 MCM	2 1/4"	240
	400 - 500 MCM		360
RSK-750	250 - 350 MCM	3 1/4"	240
	400 - 750 MCM		360